DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES Office of Structural Materials Quality Assurance and Source Inspection

Bay Area Branch 690 Walnut Ave.St. 150 Vallejo, CA 94592-1133 (707) 649-5453 (707) 649-5493



Contract #: 04-0120F4

Cty: SF/ALA Rte: 80 PM: 13.2/13.9

File #: 69.28

WELDING INSPECTION REPORT

Resident Engineer: Pursell, Gary **Report No:** WIR-000684 Address: 333 Burma Road **Date Inspected:** 23-Oct-2007

City: Oakland, CA 94607

Project Name: SAS Superstructure **OSM Arrival Time:** 630 **OSM Departure Time:** 1530 **Prime Contractor:** American Bridge/Fluor Enterprises, a JV

Contractor: Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name: CWI Present: Yes Xu Jin Long No **Inspected CWI report:** Yes N/A **Rod Oven in Use:** Yes No No N/A N/A **Electrode to specification:** Yes No Weld Procedures Followed: Yes No N/A N/A **Qualified Welders:** Yes No **Verified Joint Fit-up:** Yes No N/A N/A Yes No N/A **Approved Drawings:** Yes No **Approved WPS:** Yes N/A **Delayed / Cancelled:** No

Bridge No: 34-0006 **Component:** T-Joint

Summary of Items Observed:


Caltrans Quality Assurance (QA) Inspector, Timothy McClendon was present to observe Welding of the Caltrans Mock-up # 89.00, for the San Francisco Oakland Bay Self Anchored Suspension Bridge, at Zhenhua Port Machinery Company (ZPMC) facility on Changxing Island.

Item-1 89 Corner Splice Weld #11-B, Plate #913-4 to plate #SA24-4. Welding of the filler passes was being performed by Zhenhua Port Machinery Company (ZPMC) certified welder Wang Zhonghua #053753. Using the Shielded Metal Arc Welding (SMAW) process. The welding procedures utilized was WPS-B-T-3212-TC-U5b using welding rods 9018M-H4R. A rod box was used to maintain the specified temperature for the welding rods. The CWI present was Xu Jin Long. The welding parameters recorded by this QA Inspector were, Amps 200, Volts 25, Travel Speed 115 mm/min. and the Temperature was 165c.


Item-2 89 Corner Splice Weld# 12-B, Plate #913-3 to plate #SA24-3. Welding of the filler passes was being performed by Zhenhua Port Machinery Company (ZPMC) certified welder Dai Lu #048659. Using the Shielded Metal Arc Welding (SMAW) process. The welding procedures utilized was WPS-B-T-3212-TC-U5b using welding rods 9018M-H4R. A rod box was used to maintain the specified temperature for the welding rods. The CWI present was Xu Jin Long. The welding parameters recorded by this QA Inspector were, Amps 292, Volts 25, Travel Speed 115 mm/min. and the Temperature was 173c.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

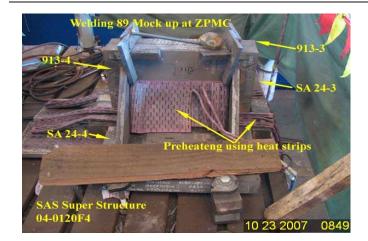



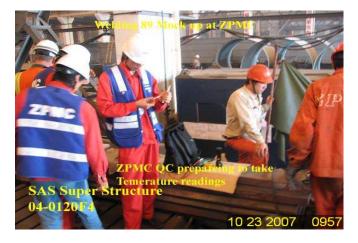

Summary of Conversations:

No relevant conversations spoken on this day.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh, (818) 292-0659, who represents the Office of Structural Materials for your project.

Inspected By:	McClendon, Timothy	Quality Assurance Inspector
Reviewed By:	Cuellar,Robert	QA Reviewer